

Medtronic International Ltd. 49 Changi South Avenue 2 Singapore 486056 Tel. +65 6436 5000

Fax +65 6776 6355 www.medtronic.com

September 14, 2015

URGENT MEDICAL DEVICE CORRECTION NOTIFICATION Potential for Instrument Breaking – Medtronic Navigated Solera Screwdrivers

Dear Valued Customer,

This letter is to notify you of the potential for the Navigated Solera Screwdriver tips to break during use and the change to the instructions for use to assist with this issue. This field correction notification impacts products sold by both Medtronic Navigation and Medtronic Spinal and Biologics.

The following products are covered by this correction notification:

P/N	Description		
9735023	DRIVER 9735023 SOLERA 5.5/6.0 MAS		
9735024	DRIVER 9735024 SOLERA 5.5/6.0 MAS CAN		
9735025	DRIVER 9735025 SOLERA 5.5/6.0 RMAS		
9735026	DRIVER 9735026 SOLERA 5.5/6.0 RMAS CAN		
9735027	DRIVER 9735027 SOLERA 5.5/6.0 FAS/SAS		
9734856	SCREWDRIVER, 9734856, SOLERA STD MAST		
9734857	SCREWDRIVER, 9734857, SOLERA RDN MAST		
9734279	SCREWDRIVER 9734279 SOLERA STANDARD		
9734373	SCREWDRIVER 9734373 SOLERA REDUCTION		
The above scre	wdrivers are used in the following kits and sets sold by Medtronic Navigation:		
9735283	INST SET 9735283 SOLERA 5.5/6.0 DRIVERS		
9735283-G02	INST SET 9735283 SOLERA 5.5/6.0 DRVR JP		
9734632	TD SET 9734632 SOLERA STD TAPS/DRIVERS		
9734647	DRVR KIT 9734647 SOLERA STD DRIVER		
9734648	DRVR KIT 9734648 SOLERA REDUCTION DRVR		
The followi	ng kits are sold by Medtronic Spinal and Biologics:		
9735281	INST KIT 9735281 DRIVER 5.5/6.0 MAS NCAN		
9735278	INST KIT 9735278 DRIVER 5.5/6.0 MAS CAN		
9735282	INST KIT 9735282 DRIVR 5.5/6.0 RMAS NCAN		
9735279	INST KIT 9735279 DRIVER 5.5/6.0 RMAS CAN		
9735280	INST KIT 9735280 DRIVER 5.5/6.0 FAS/SAS		

Description of the issue:

These screwdrivers are reusable devices which were designed for the placement of screws during spinal procedures. Complaints have been received related to broken, bent or damaged screwdriver tips, a small number of which resulted in reports of patient harm.

Under certain use conditions, the torque required to fully seat a pedicle screw may be higher than the screwdriver tip can withstand. Those conditions include:

- The hole for the screw not drilled to the proper diameter
- The hole for the screw not tapped adequately, either in the diameter or the length
- Dense bone
- Large diameter screws

The screwdriver tip breaking could result in the extension of the surgery due to the need to find a replacement screwdriver, and if broken, extract the broken tip from the screw to complete the insertion, or the removal of the tip from the patient.

Therefore, we are modifying the instructions for use for the navigated screwdrivers to add additional warnings related to the careful inspection of the instruments regularly for damage and the importance of knowledge of the operating procedures, patient selection, and product information. The revised IFUs will be included with all new navigated screwdrivers. Included with this notification is a copy of the revised instructions for use for your review and reference.

The possibility of the driver tip breaking can be increased by the use of an already damaged screwdriver. Although the inspection instructions provided in the instructions for use are adequate, following are some examples of conditions to look for during inspection:

Detail	Example Photo
Tip broken	
Tip twisted	() () () () () () () () () () () () () (

Example Photo	
	Example Photo

At Medtronic, we are committed to continually evaluating and improving the quality and reliability of our processes, products and services. Please assure that this information is provided to the personnel within your facility that perform spinal surgeries and also those individuals responsible for cleaning and sterilization of these devices.

If you have further questions regarding this communication, please contact your local Medtronic Navigation Technical Services Representative or your local Medtronic Sales Representative.

Sincerely,

Er Wei Quek Business Director Medtronic International Ltd.